

TechInfo Sheet

fax: 01344 853689

Audio Visual

email: av.technical@mail.panasonic.co.uk

Product Group: Audio

Model: SE-CH570

Date: 22/10/98

Revision No: 01

Document No: 01

Subject: Fan Motor Failure


SUBJECT: Fan Motor Failure

SYMPTOM: Power supply turns off during operation. 'F61' is displayed on the FL.
(Occurs at a level of sound volume where the fan rotates).

CAUSE: The motor fan dislocated either by a fall during transportation or by vibration, fails to rotate. Upon failure of the fan, the protector circuit turns off power supply and, at the same time, indicates 'F61' on the FL.

REMEDY: The motor fan fixing ribs are changed in shape so that the fan will not be dislocated easily.

SERVICE REMEDY:

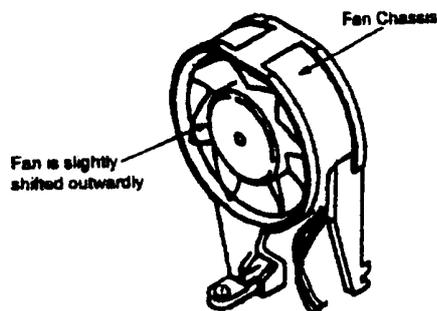

- When the fan is found dislocated, insert it. If the inserted fan works properly, it can be used as it is. (No dislocation unless the set is dropped by mistake.)
- The fan motor of which the fan come easily out after re-insertion should be replaced with new one.

ACTION ON PRODUCTION:

From August 1996 production onward.

PART REQUIRED:

REM0057 Fan Motor Ref. No. 29